

FTI-GMK2 Type 2B2 - Vehicle Coverage & Preparation Notes

FTSTECH,LLC.
SUPPORT - 1 (888) 820-3690, EXT. 203

Make	Model	Year	Install	CAN	Lights	RAP	Trunk	I/O Changes
DL-GM12					Park / Auto			Green White/Blue
Chevrolet	Silverado 1500 Key w/o On-Star / Silverado LD	2017-18 *2019	Type 2 see note	OBD-II	H			
Chevrolet	Silverado 2500 Key w/o On-Star	2017-19	Type 2	OBD-II	H			
Chevrolet	Silverado 3500 Key w/o On-Star	2017-19	Type 2	OBD-II	H			
Chevrolet	Suburban Key w/o On-Star	2017-19	Type 2	OBD-II	H			
Chevrolet	Tahoe Key w/o On-Star	2017-19	Type 2	OBD-II	H			
GMC	Sierra 1500 Key w/o On-Star / Sierra LTD	2017-18 *2019	Type 2 see note	OBD-II	H			
GMC	Sierra 2500 Key w/o On-Star	2017-19	Type 2	OBD-II	H			
GMC	Sierra 3500 Key w/o On-Star	2017-19	Type 2	OBD-II	H			
GMC	Yukon Key w/o On-Star	2017-19	Type 2	OBD-II	H			

Hey! Read this stuff before you start the installation...

Firmware:

Covered vehicles use **BLADE-AL(DL)-GM12**, flash module and update the controller firmware before installing.

Install:

Type 2 vehicles attain CAN data from the OBD-II connector, which requires the **CAN/OBD** configuration of the CAN source junction on the harness assembly. The vehicle BCM is located left of the steering column (LSC) in all covered vehicles.

***2019 Silverado & Sierra LTD:** The FTI-GMK2 harness is directly compatible with the **Silverado LD (old body style, use 2017-18 install)**, and can be modified to be compatible with the new body style Silverado/Sierra LTD by hardwiring CAN and door lock connections as follows:

CAN: White 26-pin BCM connector (CANH - pin #25, CANL - pin #24)

Door Locks: Gray 26-pin BCM connector (lock - pin #21, unlock - pin #24)

Tailgate Release: Pink 27-pin BCM connector (tailgate release - pin #14)



Lights:

Type H lights are incorporated in the harness and utilize the vehicle hazard lights for visual display of runtime status/diagnostics. Re-pinning of the CM I/O (gray) harness is required if you wish to use hazard lights, traditional parking light option is noted in the installation notes and diagram. Use of hazards also requires that you reconfigure the POC for one of the following hazard control options, **Hazard1** (POC option #30 (momentary) **or Hazard2** (POC option #23 (latching)), depending on hazard switch operation.

Locks:

CM lock connector is mandatory for this installation type. The harness is pre-wired in the harness assembly to provide the necessary analog control.

Okay, now get to work...





- FT-DAS Required for manual transmission.
- BOTH Red & Red/White MUST be connected with high current application.

Jumper	Setting
Parking Light	(+)Door Trigger In
Accessory	(-)Door Trigger In (Default)
Ignition (Default)	
Trunk	Starter
Starter	Ignition
Parking Light (Default)	Accessory (Default)

CM7000/7200

Cut loop for A/T

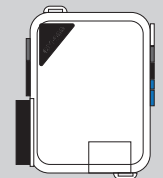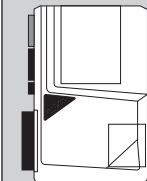

CM-900S/900AS


CM900AS/900S Jumper



START
ACC
IGN1

FTI-GMK2 Type 2B2 - Installation Notes & Wiring Diagram

- A** Hazard light connection, pin terminated, replace the wire for POC 1 in the CMx I/O connector if hazard flash is desired. See also, note **C**
- B** CAN/SWC source selector, **Type 2** installs require **CAN/OBD** configuration, as illustrated. Secure the unused BCM connector for safety.
- C** Harness is wired for runtime/diagnostic lighting via hazard lights, if traditional pk lights are desired use CM I/O (-) pk light output (**green/white**) connected to **lt. green/gray** in pin #22 of white X1 connector
- D** CM lock connector mandatory for this installation type, locks are handled by analog connections to the BCM, pre-wired in the harness assembly

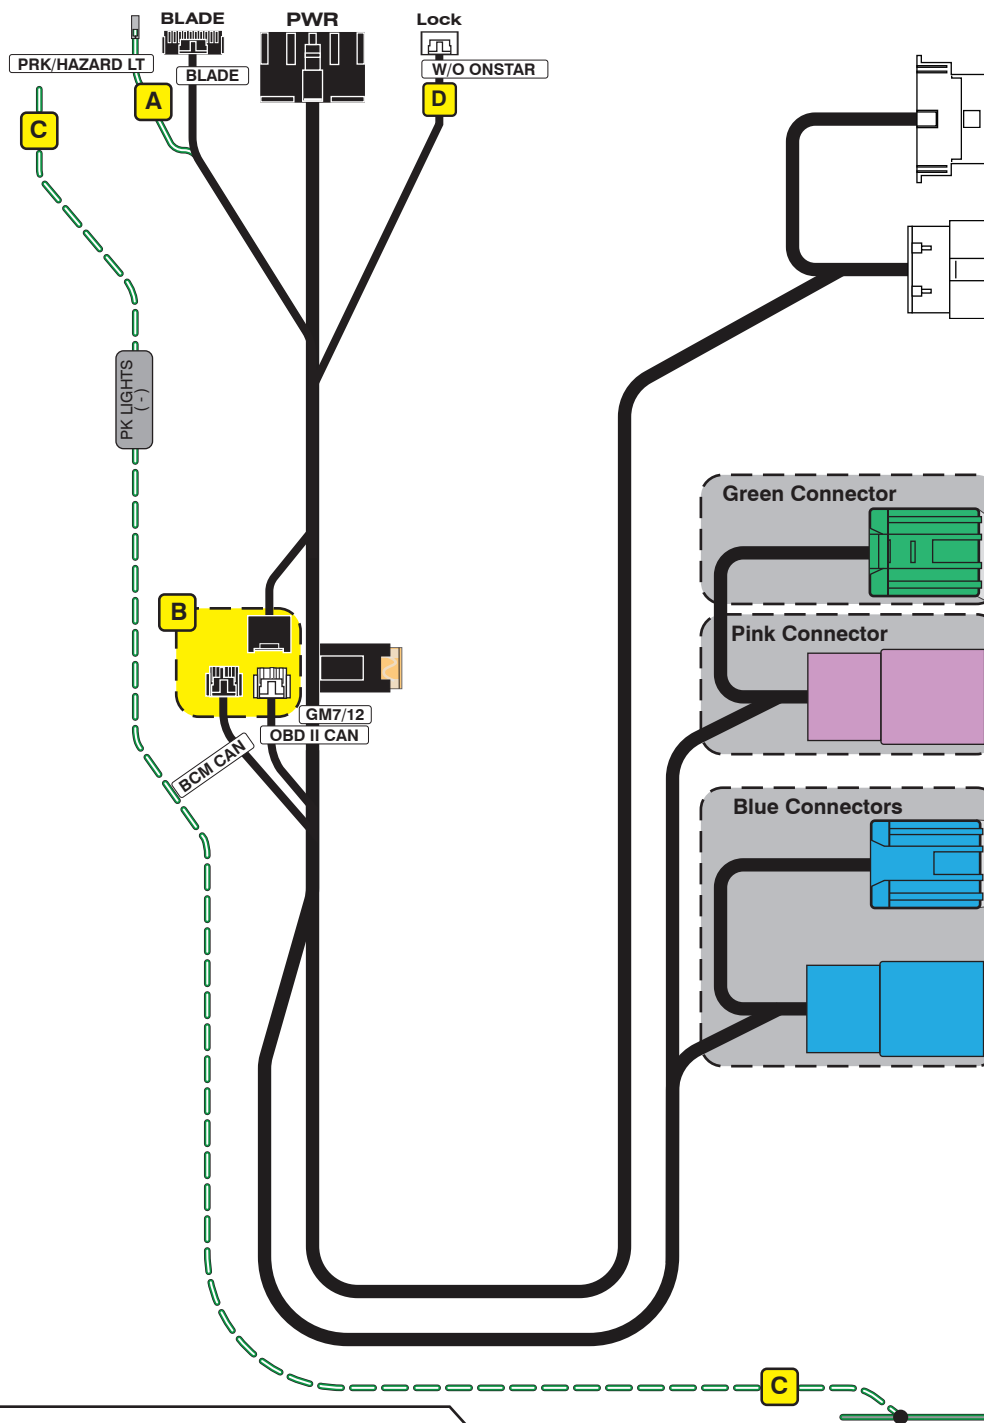

LED Programming Error Codes


Module LED flashing RED during programming

- 1x - No ACC power, check GREEN connector
- 2x - MUX status not detected, check GREEN connector
- 3x - No IGN, check GREEN connector
- 4x - No HSCAN activity, check BLUE connector
- 5x - No SWC activity, check BLUE connector
- 6x - Wrong SWC message, confirm key has been removed
- 7x - No ACC power, check GREEN connector
- 8x - No immobilizer data, check GREEN & BLADE connectors
- 9x - IGN ON, confirm key has been removed
- 10x - Keysense active, confirm key has been removed
- 11x - No ACC, confirm key is on
- 12x - No IGN, confirm key is on
- 13x - VIN not matching Weblink data, contact engineering


Module Programming Procedure

- Step 1 - Insert Key, activate IGN, wait for module to blink blue
- Step 2 - Remove key from cylinder, module should turn red
- Step 3 - Reinsert key, activate IGN, wait for LED to go off
- Step 4 - Remove then reinsert key, activate IGN again
- Step 5 - Module LED should go solid blue, programming complete


FIRSTECH, L.L.C.

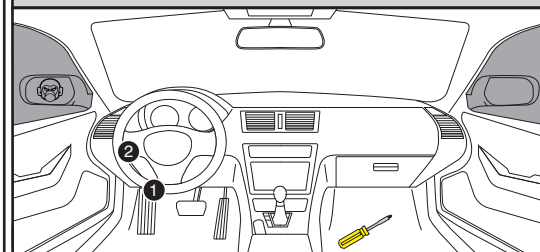

OBD-II Connector



 


1

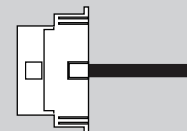


BCM

 2

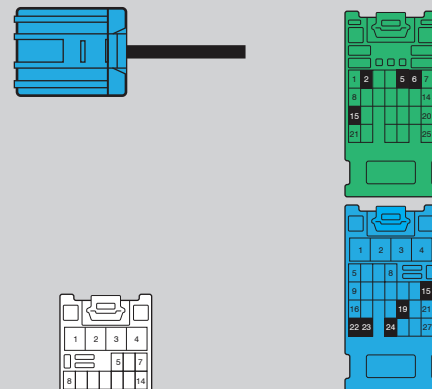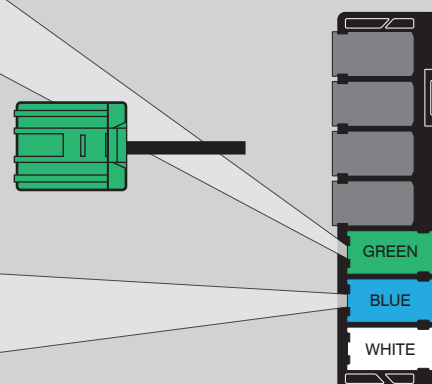

*2019 Silverado (new body style) CAN and Door Lock Wiring

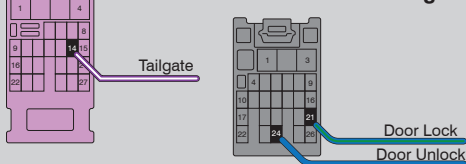

FTI-GMK2 Type 2B2

SUPPORT - 1(888) 820-3690, EXT. 203