



Overview: Production error in version 1.0 harnesses; The immobilizer wire (orange/black) is in pin position #4 instead of pin position #5. Although an effort to correct the issue was made, some quantity of harnesses did get shipped before the issue was spotted. We are advising to inspect the harness BLADE connector before attempting to install harness or program the module. This issue is not known to affect the version 2 harnesses, which require no modification.

ISSUE: Module fails to program correctly to vehicle, does not allow the vehicle to be remote started.

Correction: Step 1.) Locate the orange/black wire and confirm whether it is positioned as illustrated in Fig. 1 or Fig. 2. If the wire is as illustrated in Fig.1, proceed with Step 2 through 5 and complete the repair procedure outlined, if the wire is as illustrated in Fig. 2, correction is not necessary, proceed with harness installation and module programming.

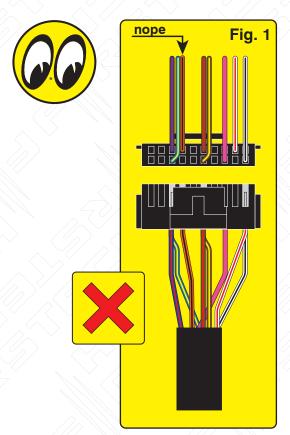

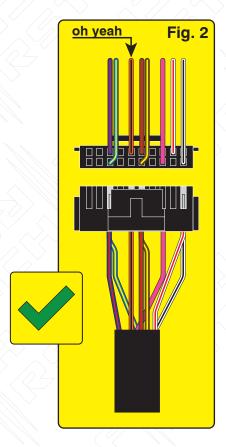

- Step 2.) Using a pick, lightly depress the catch that secures the terminal in the housing then remove the wire and terminal from the housing.
- Step 3.) Using a fine tip razor or utility knfe, inseret the blade beneath the terminal catch and raise it slightly, so that it can be reused to secure the terminal when reinserted into the BLADE connector housing.
- Step 4.) Refer to Fig, 2 for correct position of the orange/black wire (next to brown/red) then reinsert the terminal, pressing lightly until the catch 'snaps' into place, securing the terminal in the connector housing.
- Step 5.) The repair is complete, proceed with installation and programming.



FTI-STP1 v 1.0 A/T Application Bulletin/Advisory




Overview: Early versions of the FTI-STP1 harness require modification for automatic transmission (AT) applications, some of the product was able to be modified before release, but a small quantity was released without modification.


Issue: The FTI-STP1 T-harness has been designed to be compatible with A/T (automatic transmission) & M/T (manual transmission) applications, but due to an oversight in early production runs, the selection was defaulted to M/T mode.


Using a harness configured for an M/T application, in an A/T equipped vehicle, could result in vehicle module damage, it is advised that the harness be returned to A/T mode before installation in vehicles equipped with an automatic transmission.

Correction: Locate the red/black (+ Clutch) wire provided in the CN1 connector of the main harness assembly. Cut the red/black wire, either flush to the CN1 connector, or leaving enough wire exposed so that you can insulate and secure the ends of the wire that remain after cutting. Insulate each of the remaining ends of the red/black wire and secure to prevent any possibility of a short circuit. If the red/black wire has already been disconnected, no further modification is required for A/T applications

MODIFICATION REQUIRED FOR A/T APPLICATIONS, ONLY WITH v 1.0 HARNESS

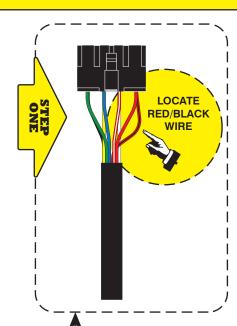


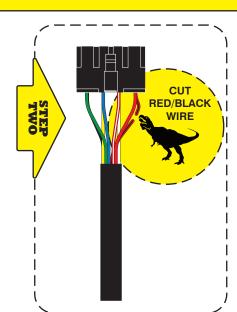


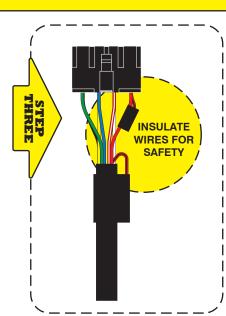



MODIFICATION NOT REQUIRED WHEN USING FTI-STP1 (v 1.0) HARNESS IN M/T APPLICATIONS, OR WHEN USING THE FTI-STP1 (v 2.0) HARNESS

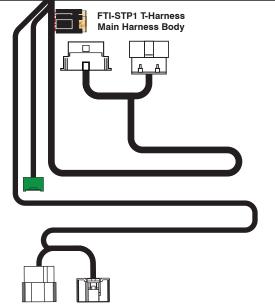

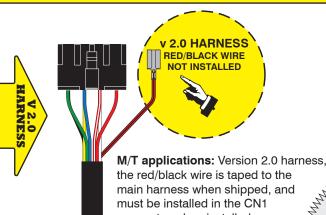

the red/black wire is taped to the main harness when shipped, and must be installed in the CN1 connector when installed.

A/T applications: Leave the red/black wire taped to the harness, it is not required for A/T applications



FTI-STP1: Vehicle Coverage and Preparation Notes

F	RSTECH, LLC. SUPPORT - 1(888) 820-3690, EXT. 203
II.	SUPPORT - 1(888) 820-3690, EXT. 203

Make	Model	Year	Install	CECU/ KAECU	Lights	ECU	POC	I/O Changes	
DL-SUB2					Park / Auto			Green White/Blue	
Subaru	Legacy PTS AT	2018-19	Type 5	BIC	DATA	PSUH or	N/A	NONE/NONE	
						JC/BFB			

This installation requires BLADE-AL(DL)-SUB2 firmware, flash module and update the controller firmware before installation.

Parking/Diagnostic Lights: Status and diagnostic light control is provided via data, no additional connections required.

Type 5 Install: Adapter B (30-pin & 28-pin connectors) is required for this install type. Adapter A (30-pin & 18-pin) is not required.

ECU/Junction Connector Locations:

BFB: Behind Fuse Box **BGB:** Behind Glove Box

BIC: Behind Instrument Cluster

PSUH or JC/BFB: Passenger Side Under Hood or Junction Connector Behind Fuse Box


Automatic Transmission Application I/O Changes:

CMX, **CM7**, and **CM9** Series controllers: No configuration changes required. See previous page for modification required at the CN1 connector parking light (+ clutch) output position.


Type 5 Immobilizer: Immobilizer connection is located at either the ECU, located passenger side of the engine compartment, or at at the 86-pin junction connector behind the fuse box. Both locations require modification of the STP1 harness by removal of the 35-pin T-section, as illustrated. The white/red & white/black wires are then extended to the required location, the white/black wire connects to the side of the wire illustrated. See illustration for specific placement of white/black.

FTI-STP1: Installation and Configuration Notes

- A ADAPTER B REQUIRED
- B ADAPTER A DO NOT USE
- MODIFICATION REQUIRED REMOVE CONNECTOR
- CONNECTION REQUIRED TWO POSSIBLE LOCATIONS, LOOK FOR JUNCTION CONNECTOR FIRST, THEN GO TO UNDER HOOD LOCATION IF NOT FOUND.
- E SPECIAL ATTENTION REQUIRED

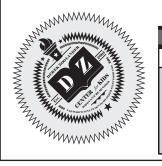

	FEATURE COVERAGE																				
0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0		0
IMMOBILIZER DATA	ARM OEM ALARM	DISARM OEM ALARM	роов госк	DOOR UNLOCK	TRUNK/HATCH RELEASE	A/M CONTROL FROM OEM REMOTES	A/M CONTROL FROM DOOR HANDLE	BRAKE STATUS	E-BRAKE STATUS	DOOR STATUS	TRUNK STATUS	P/N SWITCH STATUS	VSS STATUS	тасн оитрит	SECURE TAKEOVER	AUTO TAKEOVER	RAP SHUTDOWN	A/M REMOTE START FROM OEM REMOTE	PARKING LIGHTS	POWER LIFTGATE	DISCO BALL

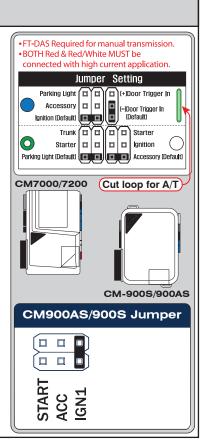




DOORLOCK INTERFACE ______SUBARU

Patent No. US 8,856,780 CA 2759622

Page 32 of 34 COM-BLADE-AL(DL)-SUB2-EN Doc. No.: ##75546## 20210416

 CARTRIDGE INSTALLATION



Slide cartridge into unit. Notice button under LED.

2

Ready for Module Programming Procedure.

MODULE PROGRAMMING PROCEDURE

NOTE

When programming, only one keyfob will be used. The other one must be located at least 10 feet away from the vehicle.

1 PROJECT X2

Push start button twice [2x] to ON position.

2

LED will turn solid RED.

3 ENGINE ON START STOP

 
Start engine.

4

Wait, LED will flash BLUE rapidly.



Push start button once [1x] to OFF position.



WARNING:
Disconnect power last.
Disconnect RS from vehicle.

7	
	Ø KLÖN

Connect RS to computer and proceed with extended programming.



WARNING: Connect power first. Connect RS to vehicle.



Push start button twice [2x] to ON position.



LED will turn solid RED.



Start engine.



Wait, LED will turn solid BLUE.



Push start button once [1x] to OFF position.

14

Module Programming Procedure completed.



DOORLOCK INTERFACE SUBARU

Patent No. US 8,856,780 CA 2759622

Page 34 of 34 COM-BLADE-AL(DL)-SUB2-EN Doc. No.: ##75546## 20210416

WARNING: READ BEFORE REMOTE STARTING THE VEHICLE

IMPORTANT

I All vehicle doors must be closed and locked prior to remote start sequence. Failure to comply will result in remote starter malfunction.

TAKE OVER PROCEDURE - TO THE VEHICLE OWNER

NOTE

I All vehicle doors must be closed and locked prior to remote start sequence.

 


TIME RESTRICTI ON COMING UP!

1




Press UNLOCK on after-market remote.



TIME RESTRICTI IN

Within 45 SECONDS from previous step:

 Have a valid key on you. Open vehicle door. Enter vehicle. Close vehicle door.



Take over procedure completed.



Failure to follow this procedure will result in a vehicle engine shutdown.