 




Headlight Switch

1




Gateway Module

 2

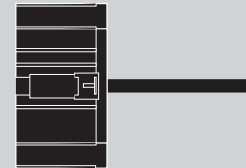

D

IF THE VEHICLE IS NOT EQUIPPED WITH AN OEM HOOD SWITCH: CONNECT BLACK/GRAY WIRE TO BLUE/ORANGE WIRE IN LATCH CONNECTOR AND INSTALL AN AFTERMARKET HOOD SWITCH.

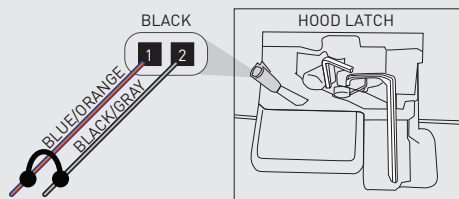

LED Programming Error Codes

Module LED flashing RED during programming

- 1x - No CAN activity, confirm BLADE 1 or BLADE 2 connector
- 2x - No ignition, confirm BLADE 1 or BLADE 2 connector
- 3x - No communication with BCM, confirm compatibility
- 4x - Unable to activate OEM RS, confirm compatibility
- 5x - Unable to activate OEM RS, firmware will not work
- Fast Blink - CAN connection, reverse BLADE 1/2 connector

CARTRIDGE INSTALLATION



1 Slide cartridge into unit. Notice button under LED.

2

Ready for Module Programming Procedure.

MODULE PROGRAMMING PROCEDURE

 
1



CONNECT BLADE connector 'A', proceed with Step 1 programming


2

OFF ACC ON START



Set ignition to ON position.

 3




Wait, LED 1 will turn solid RED.

4



Wait, LED 1 will flash BLUE once [1x].

 
5



Wait, LED 1 will turn solid RED.

6

 OFF ACC ON START



Set ignition to OFF position.

 
7



DISCONNECT BLADE connector 'A',
CONNECT BLADE connector 'B'.
proceed with Step 2 programming


8

OFF ACC ON START




Set ignition to ON position.

 9




Wait, LED 1 will turn solid RED.

 10



Wait, LED 1 will flash BLUE rapidly.

 
11



Wait, LED 1 will turn solid BLUE for 2 seconds.

12

 OFF ACC ON START



Set ignition to OFF position.

13

Module Programming Procedure completed.

TAKE OVER PROCEDURE - TO THE VEHICLE OWNER

NOTE

- I All vehicle doors must be closed and locked prior to remote start sequence.

1



Press unlock on OEM or aftermarket remote or request switch.

2



DO NOT PRESS BRAKE PEDAL. Set ignition to ON position. Wait 2 seconds for key validation.

3



Press and release BRAKE pedal.

4

Take over procedure completed.



Failure to follow procedure will result in vehicle engine shutdown.