# FTI-NSP2 Type 2 - Vehicle Coverage & Preparation Notes

F	RSTECH, LLC. SUPPORT - 1(888) 820-3690. EXT. 203
1	SUPPORT - 1(888) 820-3690, EXT. 20

Make	Model	Year	Install	CAN	Lights	ВСМ	POC1	I/O Changes
DL-NI8					Park / Auto			Green White/Blue
Infiniti	QX50 PTS	2019	*Note	XXX	XX/XX	XXX	XXXXXXX	
Nissan Nissan	Quashqai Rogue PTS	2017-19 2014-16	Type 2 Type 2	BCM OBD-II	CM I/O CM I/O	DSD	Hazard1/2 Hazard1/2	
Nissan Nissan Nissan	Rogue PTS Rogue Sport Altima PTS (validation required)	2017-20 2017-19 2019	Type 2 Type 2 Type 2	BCM BCM BCM	CM I/O CM I/O CM I/O	DSD DSD DSD	Hazard1/2 Hazard1/2 Hazard1/2	

Hey! Read this stuff before you start the installation...

#### Firmware:

Covered vehicles use BLADE-AL(DL)-NI8, flash module and update the controller firmware before installing.

### CAN:

CAN data is acquired from the BCM using the BCM CAN connector cable, connect, secure against main harness body, and route securely.

### POC1:

Visual status confirmations and diagnostic information are provided by hazard light connections in the harness assembly, POC1 must be configured for either **Hazard1** (POC option #30 (momentary switch) **or Hazard2** (POC option #23 (latching switch).


## **Vehicle Damage Warning:**

Caution should be taken to avoid mixing up the BCM connectors, vehicle damage will result if the connectors are positioned improperly. It is advised that you make the BCM connections one at a time, confirming that each T-harness connection is at the correct BCM position before proceeding to the next connection, attempting to program, or attempting to remote start.


**CM Unlock Configuration:** Covered vehicles require configuring the controller unlock output to double-pulse unlock. Set feature option 1-04 to setting 2 (unlock).

**2019 Infiniti QX50:** This vehicle has been removed from coverage while the harnesses are being revised to properly interface with the vehicle door locks. The install can be completed using the NSP2 harness, but requires additional wiring to control the door locks, and disconnecting the lock provisions currently included in the harness. If you wish to complete this install, contact our technical support department for additional information.

Okay, now get to work...

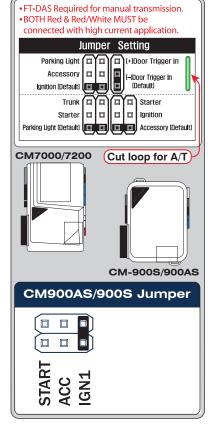



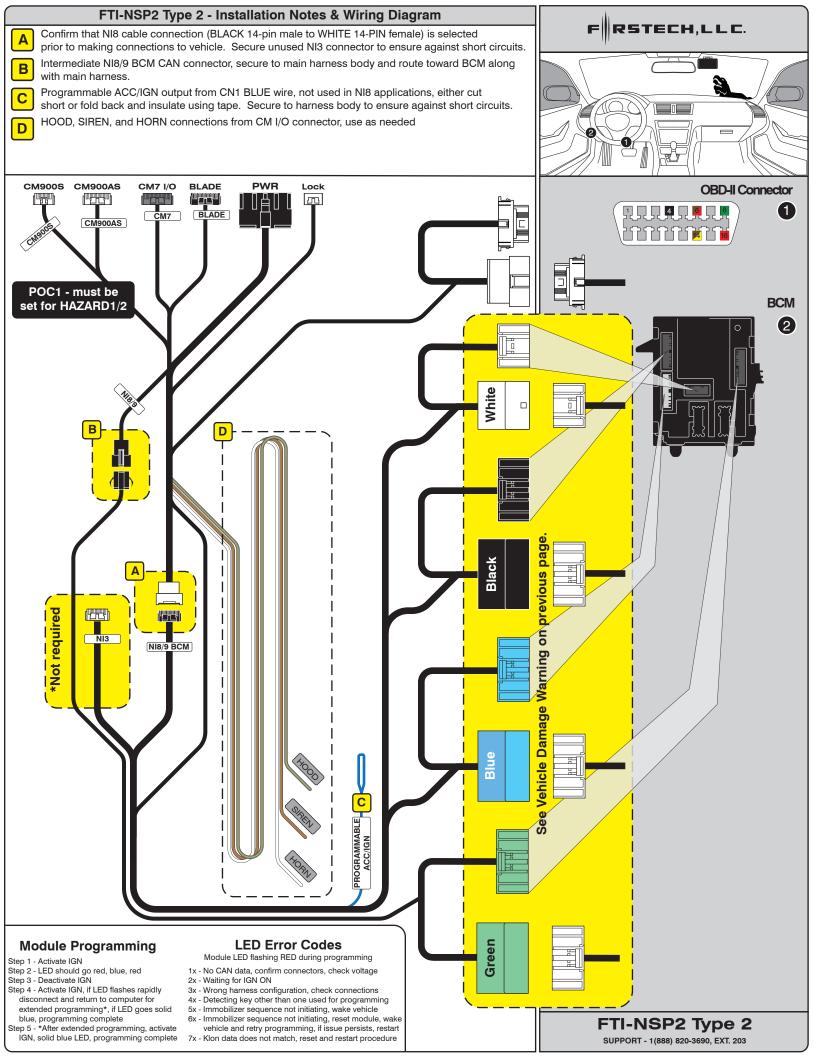

# FTI-NSP2 Harness Bulletin - Mis-wired POC1 (parking lights)



Overview: The initial production release of the FTI-NSP2 harness has an issue where the POC1 circuit is incorrectly positioned in the CM7 I/O connector. This issue affects only the gray 20-pin CM7 I/O connector illustrated below in figure 1.

Issue: The green/white parking light circuit is positioned in pin position #17, the fixed light output where the green/white wire is typically placed for parking lights, but the harness solution uses the vehicle hazard lights instead, the result when used as supplied is an erratic light display.

#### Correction:

- 1.) Use a pick tool to depress the locking tab on the terminal connector of the green/white wire
- 2.) Remove wire and prepare to reposition
- 3.) Once removed, reposition the locking tab by using a razor knife to lift the tab into a usable position
- 4.) With locking tab repositioned, relocate to pin position #1 (top right position as illustrated)
- 5.) Push the terminal connector into the I/O connector housing until the locking tab clicks into place and the wire is secure
- 6.) Correction complete, you may now complete the installation, but remember to configure POC1 for Hazards (setting #30)

