










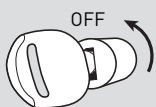
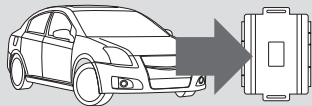


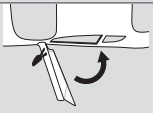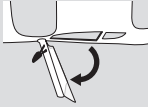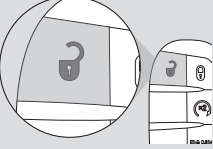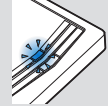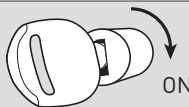
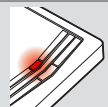
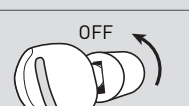
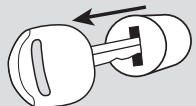
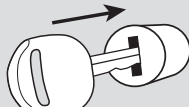
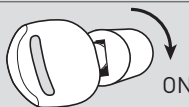


MODULE PROGRAMMING PROCEDURE - WITH KLON

- 1  Close driver door.
- 2  Re-open driver door to wake up data bus.
- 3  Press UNLOCK on OEM remote.
If the vehicle is not equipped with an OEM remote, press the module programming button.
- 4  Wait, LED will flash BLUE once [1x].
- 5  Turn key to ON position.
- 6  Wait, LED will turn solid RED.
- 7  Turn key to OFF position.
- 8  Remove key.
- 9  Insert key into ignition.
- 10  Turn key to ON position.
- 11  Wait, LED will flash BLUE.

- 12  Turn key to OFF position.
- 13  **WARNING:**
Disconnect power last.
Disconnect RS from vehicle.
- 14  Connect RS to computer and proceed with extended programming.
- 15  **WARNING:** Do not press RS programming button.
Connect power first.
Connect RS to vehicle.
- 16  Turn key to ON position.
- 17  Wait, LED will turn solid BLUE for 2 seconds.
- 18  Turn key to OFF position.
- 19  Turn key to START position.
- 20  Turn key to OFF position.
- 21  Module Programming Procedure completed.

WARNING: READ BEFORE REMOTE STARTING THE VEHICLE

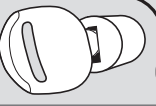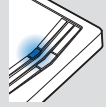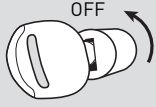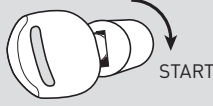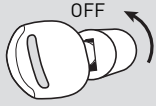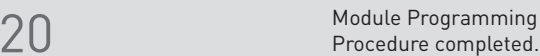IMPORTANT

- All vehicle doors must be closed and locked prior to remote start sequence. Failure to comply will result in remote starter malfunction.

TAKE OVER PROCEDURE - TO THE VEHICLE OWNER

NOTE

- All vehicle doors must be closed and locked prior to remote start sequence.




TIME RESTRICTION COMING UP !

1



Press UNLOCK on after-market remote.

2

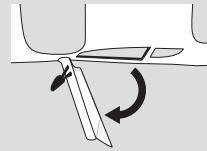

TIME RESTRICTION

Within 45 SECONDS from previous step:

- Open vehicle door.
- Enter vehicle.
- Close vehicle door.
- Insert key into ignition.
- Turn key to ON position.
- Press and release BRAKE pedal.

3

Take over procedure completed.



Failure to follow procedure within time restriction will result in vehicle engine shutdown.