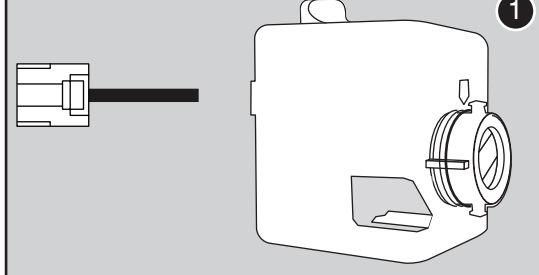


**Wireless Ignition Node** 1



**Headlight Switch** 2



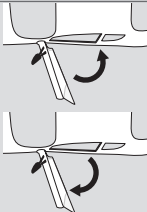

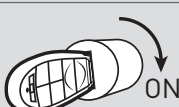
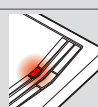
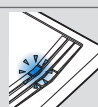
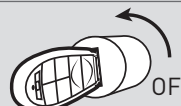


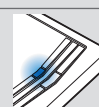
**Driver kick panel harness** 4

Morado (-)

**Códigos de error de programación de LED**

- El LED del módulo parpadea en ROJO durante la programación
- 1x - CAN problema
  - 2x - Inmovilizador (confirme que el vehículo está equipado, presione el botón si no)
  - 3x - Inmovilizador (confirme que el vehículo comienza con la llave)
  - 4x - Sin información VIN
  - 5x - VIN no coincide (póngase en contacto con soporte)

## MODULE PROGRAMMING PROCEDURE

- |    |  |   |
|----|--|---|
| 1  |   | Close driver door.<br><br>Re-open driver door to wake up data bus.  |
| 2  |   | Insert key into ignition.   |
| 3  |   | Turn key to ON position.  |
| 4  |   | LED will turn solid RED.  |
| 5  |  | Within 5 seconds, LED will flash BLUE rapidly.  |
| 6  |  | Turn key to OFF position.   |
| 7  |  | Remove key.   |
| 8  |  | Press UNLOCK on the OEM remote.<br><br>If vehicle is not equipped with OEM remote, press module programming button. |
| 9  |  | Wait, LED will turn solid BLUE for 2 seconds.   |
| 10 |  | Module Programming Procedure completed.   |

## WARNING: READ BEFORE REMOTE STARTING THE VEHICLE

### IMPORTANT


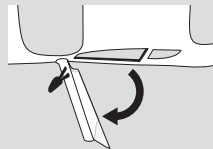
- All vehicle doors must be closed and locked prior to remote start sequence. Failure to comply will result in remote starter malfunction.


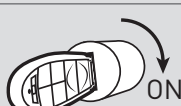

## TAKE OVER PROCEDURE - TO THE VEHICLE OWNER

### NOTE

- All vehicle doors must be closed and locked prior to remote start sequence.



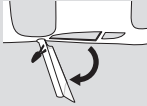



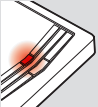
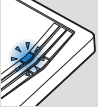


- |   |   |  |
|---|---|--|
| 1 |  | Press UNLOCK on after-market remote.   |
| 2 |  | <b>TIME RESTRICTION</b><br>Within 45 SECONDS from previous step:<br><br>Open vehicle door.<br>Enter vehicle. |

- |   |  |  |
|---|--|--|
| 3 |  | Insert key into ignition.  |
| 4 |  | Turn key to ON position.<br><br>Wait 2 seconds for key validation. |
| 5 |  | Press and release BRAKE pedal.                                     |
| 6 |  | Take over procedure completed.                                     |

**!** Failure to follow procedure within time restriction will result in vehicle engine shutdown.

## MODULE PROGRAMMING PROCEDURE - PUSH TO START

- |   |   |  |   |  |  |
|---|---|--|---|--|--|
| 1 |  | Close driver door.   | 5 |  | DO NOT PRESS BRAKE PEDAL<br>Push start button once [1x] to OFF position. |
|   |  | Re-open driver door to wake up data bus.                                 | 6 |  | Press UNLOCK on the OEM remote.  |
| 2 |  | DO NOT PRESS BRAKE PEDAL<br>Push start button twice [2x] to ON position. | 7 |  | Wait, LED will turn solid BLUE for 2 seconds.                            |
| 3 |  | LED will turn solid RED.   | 8 |  | Module Programming Procedure completed.                                  |
| 4 |  | Within 5 seconds, LED will flash BLUE rapidly.                           |   |  |  |

## WARNING: READ BEFORE REMOTE STARTING THE VEHICLE

### IMPORTANT




- All vehicle doors must be closed and locked prior to remote start sequence. Failure to comply will result in remote starter malfunction.

## TAKE OVER PROCEDURE - PUSH TO START - TO THE VEHICLE OWNER

### NOTE

- All vehicle doors must be closed and locked prior to remote start sequence.

 TIME RESTRICTION COMING UP !

- |   |   |   |   |  |  |
|---|---|---|---|--|--|
| 1 |  | Press UNLOCK on after-market remote.  | 3   |  | DO NOT PRESS BRAKE PEDAL<br>Push start button twice [2x] to ON position.<br><br>Wait 2 seconds for key validation. |
| 2 |  | TIME RESTRICTION<br>Within 45 SECONDS from previous step:<br><br>Open vehicle door.<br>Enter vehicle. | 4   |  | Press and release BRAKE pedal.   |
|   |   |   | 5   |  | Take over procedure completed.   |
|   |   |   |  Failure to follow procedure within time restriction will result in vehicle engine shutdown. |  |  |